

GUWA200

## Wireless USB Adapter




### Unplug and Play

The Wireless USB Adapter enables your PC to wirelessly connect to USB devices\*. With Wireless USB you get all the functionality of USB, without the cable clutter. By adding the Wireless USB Adapter to your PC, a wireless connection is made between your PC and Wireless USB devices. Your PC can now wirelessly communicate up to 30-feet away with any USB device that is plugged into your Wireless USB hub or other Wireless USB built-in devices anywhere in the same room as your PC\*.



#### How does it work?

- Plug in the included Wireless USB Adapter to your PC to make the PC Wireless USB-enabled
- Pair your PC with the Wireless USB Hub-GUWH204, or Wireless USB to VGA Adapter-GUW2015V, both sold separately
- Print, scan, access your external hard drive wirelessly or view your computer's desktop on a remote display without cable clutter

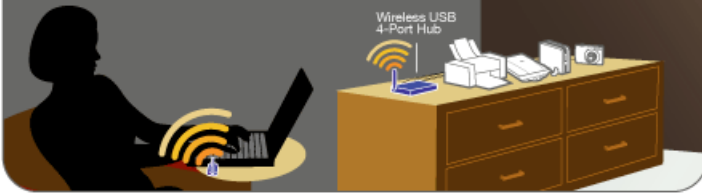

#### Requirements

- Microsoft Windows® XP 32-bit (Service Pack 2), Microsoft Windows® Vista® 32/64-bit
- USB 2.0 Compliant PC
- Wireless USB Certified Devices

#### Package Contents

- 1 x Wireless USB Adapter (for PC)
- 1 x USB 2.0 Extension Cable (5 ft.)
- 1 x Quick Start Guide
- 1 x Installation CD
- 1 x Registration / Warranty Card

## Specifications

Function	GUWA200
<b>Operating System Support</b>	Microsoft XP 32-bit; Microsoft Vista 32/64-bit
<b>PHY Data Rate</b>	53.3Mbps, 80Mbps, 106.6Mbps, 160Mbps, 200Mbps, 320Mbps, 400Mbps, 480Mbps
<b>Operating Range</b>	Up to 30 feet (10 meters)
<b>Frequency</b>	3.1GHz to 4.8GHz (WiMedia Band Group 1)
<b>Number of Channel</b>	7 channels (3 FFI + 4 TFI)
<b>RF Modulation Type</b>	QPSK/DCM
<b>Data Rate</b>	PHY Rate 480 Mbps
<b>USB Specification</b>	Certified Wireless USB 1.0; USB 2.0
<b>Connectors</b>	
USB	USB 2.0, type A
<b>Security</b>	Highly Secured Wireless Connection (AES 128 bits)
<b>Antenna Type</b>	Omni directional
<b>LEDs</b>	
Link	Blinking when data is being transferred
Power On	Solid after plugging into USB 2.0 port
<b>Power Consumption</b>	1.2W
<b>Environment</b>	
Humidity	10-95% RH, Non-condensing
Operation Temperature	0 to 50 degree C
Storage Temperature	0 to 75 degree C

Dimensions	GUWA200
<b>POP Information</b>	
10" Peg Hook	6
6" Peg Hook	3
<b>Unit Dimensions</b>	
Height	0.50 in
Depth	1.01 in
Width	2.875 in
<b>Inner Pack</b>	
Height	7.40 in
Length	4.843 in
Width	5.945 in
Inner Pack Qty.	3
<b>Unit Package Dimensions</b>	
Height	5.71 in
Width	5.71 in
Depth	1.54 in
<b>Master Carton</b>	
Height	7.874 in
Width	20.157 in
Depth	12.598 in
Master Carton Qty.	24 units (8 inner packs)
<b>Weight</b>	
Master Carton Wt.	14.09 lbs
Inner Pack Wt.	1.761 lbs
Unit Pack Wt.	0.5 lb
Unit Wt.	0.06 lb